



Lexan® Hardcoated Polycarbonate  
 VStream® Windscreen  
 N20057, Short Dark Tint  
 N20058, Mid Light Tint  
 N20059, Tall Clear  
 For Honda Africa Twin

Thank you for purchasing a National Cycle product. Read these instructions carefully and thoroughly before beginning work. Dealers, if installing this windscreen for a customer, please give them this manual. It contains information needed to properly maintain and use this product.



**Attention:**

Special notes and cautionary measures which can prevent damage to the accessory or motorcycle.



**Note:**

Tips for facilitation of operation, control and adjustment, as well as maintenance work.

**CONTENTS OF KIT**

Item	Description	Part No.	Qty.	Notes and Tools
1	VStream® Windscreen		1	All Stock Hardware Will Be Re-used



**TOOLS**

5mm Hex Key



**PREPARATION**

1. Place motorcycle securely on its side stand.

**INSTALLATION**



**All stock hardware will be reused.**

1. Remove the upper two allen screws and washers. Wellnuts will remain in the brackets. (5mm Hex Key) **Figure 1**

Figure 1



Figure 2

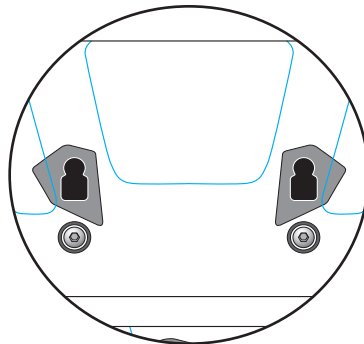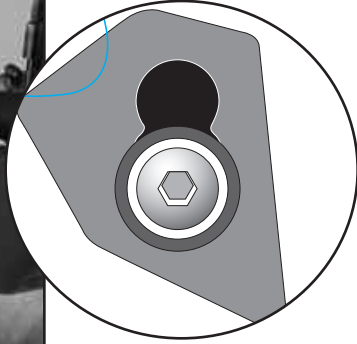

## INSTALLATION

2. Loosen, but Do Not remove the lower two allen screws. **(5mm Hex Key) Figure 2**
3. Slide the shield downwards until it bottoms out, then pull the shield off the bracket. Figure 2



Figure 3



Figure 4

## Lower Hardware Removal and Reinstallation

4. Remove the wellnuts, screws and washers from the lower two holes in the OEM screen. **(5mm Hex Key) Figure 3**
5. Reinstall the wellnuts, screws and washers into the lower two holes of the VStream Windshield. **(5mm Hex Key) Figure 4**
6. Insert the lower two wellnuts into the lower "squared" area of mount bracket. Push shield onto bracket. **Figure 5**
7. Push Shield upwards until it stops. **Figure 5a**



Figure 5

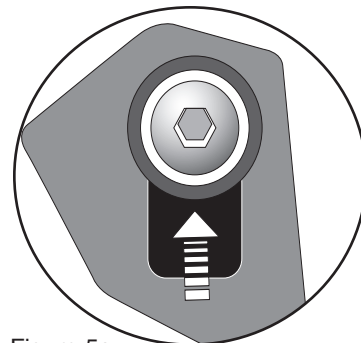
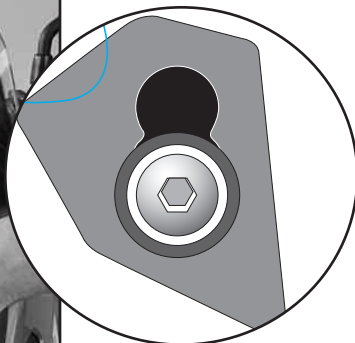


Figure 5a



Figure 6

### Upper Hardware Installation

8. While holding the wellnut from behind the bracket, reinstall the upper screws and washers. Tighten screws firmly, but do not over tighten. **(5mm Hex Key) Figure 6**

### Tighten Lower Hardware

8. Tighten the lower two screws firmly. Do not overtighten. **(5mm Hex Key) Figure 6a**

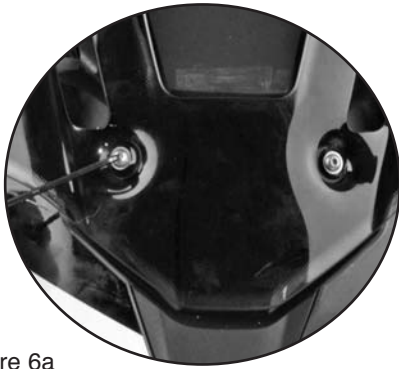


Figure 6a



## Enjoy your new VStream® Windshield

**CLEANING AND MAINTENANCE** To clean the screen, wash with a clean soft cloth, plenty of warm water and if necessary, a non-abrasive soap such as dishwashing liquid. Flannel or soft chamois make good cleaning cloths. **Paint, glue residue or grease removal:** Moisten cotton with naphtha or turpentine followed by a wash as above. National Cycle **Shield Wash™** (N1401-01) makes a good daily cleaner and comes with a handy travel size bottle. Shield Wash is safe for all windshields and helmet visors.

Do not clean polycarbonate in hot sun or high temperatures. Do not clean the screen with glass cleaners.

Do not allow brake fluid, alcohol, or strong solvents to contact the screen.

**RAIN REPELLENT** Do not use rain protective products made for glass. We recommend National Cycle's **RainZip®** (N1410-01) to keep your windscreen clear in rainy weather.

## ! WARNING

Never ride your motorcycle with loose accessory mounting hardware. Check the hardware for tightness regularly.

Today's motorcycles are built with enough frame rigidity to withstand the moderate loads imposed on them by the foreseeable addition of an accessory(ies). If an accessory(ies) adversely affects your motorcycle's stability, immediately remove the accessory(ies). Do not ride a motorcycle that exhibits unsafe handling traits.

Have experienced service personnel correct any problem before riding with the accessory(ies) installed. For further questions concerning handling problems associated with an accessory(ies), contact your dealer, motorcycle manufacturer, or accessory manufacturer.

**Sunlight reflected off the inside curvature of the windscreen can, at certain times of day, cause extreme heat buildup on the motorcycles instruments and possibly even melt them. Exercise care in parking to avoid this. Park your motorcycle facing the sun or place an opaque object over this area.**



Register your windshield online at [www.nationalcycle.com](http://www.nationalcycle.com)

### National Cycle 3-Year Limited Warranty

National Cycle hereby warrants to the original registered owner of a National Cycle polycarbonate windshield for a period of three years from the date of purchase against breakage. This limited warranty is expressly limited to the replacement of the polycarbonate windshield. This limited warranty does not include scratches, coating failure, cosmetic wear and tear, replacement of hardware, or any consequential damages or expenses including labor cost of installation, removal and/or replacement, inconvenience, inbound freight expenses or damage to any other component of the motorcycle or any other accessories. Certain chemicals, generally known as acidic hydrocarbons, are known to cause polycarbonate damage and will not be covered under this limited warranty. Please refer to the cleaning instructions supplied with all National Cycle windshields.

Visit [www.nationalcycle.com](http://www.nationalcycle.com) for further details, or call or write National Cycle

VStream® windshield patent no. 7,387,328

National Cycle, Inc. PO Box 158 Maywood, IL 60153-0158 USA

708-343-0400 / Fax: 708-343-0625 / [www.nationalcycle.com](http://www.nationalcycle.com) / e-mail: [info@nationalcycle.com](mailto:info@nationalcycle.com)